DrägerService®

JULIAN
TECHNICAL SERVICE BULLETIN #27

Product: Julian

Date: March 23, 2001

Re: **Corrective action**- replacement of Man/Spont-Auto switchover diaphragm located in valve plate of the breathing system.

Reference Doc: 03/01 Maxeiner No.: 27
Released 3/9/2001

Reason/Rational: To enhance the reliability of the Man/Spont switchover valve.

Solution/Procedure: Replacement of individual diaphragms of diaphragm assembly for Man/Spont-Auto switchover.

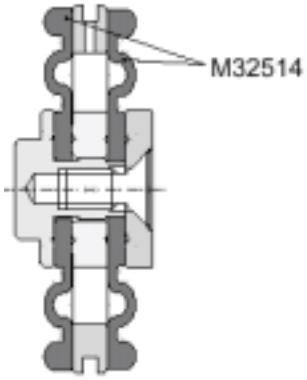

Notice: When fitting the diaphragm(s), pay special attention to the correct fitting position (see drawing). Secure the screw with Loctite 221.

Devices affected: All units manufactured prior to December 2000. (serial numbers prior to ARPN-xxxx)

Timing/When: During next repair or Preventative Maintenance Certification visit, but **action must be completed by March 2003**.

Cost: Parts will be supplied free of charge up to the completion date of March 2003.

Time Required: Without wait or travel times:

DrägerService
3122 Commerce Drive
Telford, PA 18969
Tel: (215) 721-5402
(800) 543-5047
Fax: (215) 723-5935
Web: www.draegermedical.com

DrägerService®

Disassembly and assembly of the diaphragm assembly: 10 min
Function test: 15 minutes

Total: 25 minutes

Ordering Info/Parts: **M32514**- (2x for each breathing system) Man/Spont diaphragm. Diaphragms can be ordered free-of-charge through Customer Service.

Checking/Testing: Functional test: Carry out power on test, check ventilation parameters according to section 4.18- Ventilation Modes, of the Safety and Function test.

Distribution: All Authorized Service Organizations, DragerService.

If you have any questions, please contact Technical Support by phone at 1-800-543-5047 or by fax at 1-215-721-5789.

DrägerService
3122 Commerce Drive
Telford, PA 18969
Tel: (215) 721-5402
(800) 543-5047
Fax: (215) 723-5935
Web: www.draegermedical.com